

A/T - Column Shift Lever Binding

90toyota09

TRANSMISSION &

REFERENCE CLUTCH

NUMBER 041
DATE 12-21-90
MODEL TRUCKS (RN/VN)
W/ COLUMN SHIFT

TITLE SHIFT INTERLOCK CABLE REPLACEMENT

CONDITION:

RN/VN Automatic Transmission trucks with column shift having difficulty moving the shift lever.

POSSIBLE CAUSE:

Shift Interlock Cable binding.

REPAIRS:

Repairs require the replacement of the Shift Interlock Cable, Cable End Rod Holder and the Brake Pedal Return Spring.

PART No. INFORMATION:

<http://www.alldatadiy.com/alldata/AFI~V2164758~C10566~R0~OD~N/...> 4/30/03

1990 Toyota Truck Pickup 2WD V6-180.5 2959cc 3.0L SOHC (3VZ-E) -... Page 2 of 2

Prev. Part No.	New Part No.	Part Description
33880-35010	*33880-35011	Shift Interlock Cable
33883-35010	*33883-35020	Cable End Rod Holder
90507-17001	*90507-18026	Brake Pedal Return Spring

* All three parts must be replaced as a set only

PRODUCTION EFFECTIVE:

Starting VIN	P/D
JT4RN81 * # L5079549	4/90
JT4RN81 * # L0049371	" "
JT4RN82 * # L5024424	" "
JT4RN82 * # L9006312	" "
JT4RN93 * # L5020153	" "
JT4RN93 * # L9001492	" "
JT#VN82 * # L5003358	" "
JT#VN82 * # L0006226	" "
JT4VN93 * # L5013549	" "
JT5VN94T # L0018143	" "